

To:  
Jose Vela  
Contracting Officer Representative  
IBWC

Copies:  
Padinare Unnikrishna (USIBWC)  
Armando Flores (Arcadis)

Arcadis U.S., Inc.  
10352 Plaza Americana Drive  
Baton Rouge  
Louisiana 70816  
Tel 225 292 1004  
Fax 225 218 9677

From:  
Kirk Lowery, P.E.

Date:  
July 16, 2020

Arcadis Project No.:  
LA003315.0000

Subject:  
July 2020 Summary Report of Inclinator Readings  
Remediation Design of Levee Floodplain Failure within the  
Upper Brownsville Levee Reach Lower Rio Grande Flood  
Control Project – IBM15D0001 – IBM15T0015

---

## 1. Introduction

Arcadis U.S., Inc. (Arcadis), is pleased to submit this summary technical memorandum including data charts of the slope inclinometer readings at the IBWC site. The baseline readings for the new inclinometers, ARC-1, ARC-2, ARC-3 and ARC-4, were taken in June 2016 and the twelfth set of readings were measured on July 10, 2020 and ARC-1 was re-read on July 13, 2020. Under the current scope of work, this set of readings will be the last measurement to be taken for these inclinometers.

Readings for the United States Corps of Engineers' (USACE) inclinometers, I-32, I-33 and I-34, were not taken for fear of getting the inclinometer probe stuck in the already constricted areas of the pipe due to previous soil movement.

As noted in the March report, several pins that were installed June 14, 2017 have been removed. The removed pins were predominantly on top of the levee near inclinometer ARC-1 and south of the existing retaining wall. It is assumed that pins were removed by active traffic on the levee roadway and by grass mowing activities. Attachment C shows photos of the top of the levee where tension cracks were present in July 2017.

The readings for each inclinometer are reflected in the graphical displays provided in Attachment A. Attachment A includes both incremental and cumulative displacement plots. Attachment B shows the inclinometer locations on a Google Map.

The incremental displacement plot compares the mean deviation data to the baseline survey file. This plot reveals the exact depth where displacements are actually occurring. The cumulative displacement is the sum of the displacements from the base of the borehole. This plot shows the change in the position of the casing from the first set of readings.

The A-axis charts in the displacement plots show displacements in the plane perpendicular to the levee while the B-axis charts show displacements in the plane parallel with the levee. A positive reading in the A-axis chart indicates displacement to the west heading toward the Rio Grande, and a positive reading in the B-axis chart indicates displacement to the north heading toward the Gateway Bridge.

## 2. Digitilt AT Inclinometer

Digitilt AT system was used to survey the inclinometers. The system components include an inclinometer probe, control cable, a Bluetooth reel and the Digitilt Reader app for certified Android-based tablet computer. The equipment is shown in Figure 1.

Figure 1: Digitilt AT System Components.



## 3. July 2020 Inclinometers Assessment

Previous readings of the inclinometers were repeated with specific Digitilt equipment that since the March reading was damaged. The readings made this month were made with different equipment than previously used. As such the readings are slightly different and correcting the new readings using the equipment's calibration data did not provide meaningful corrections. What is provided in Attachment A is the data collected on July 10<sup>th</sup> with the new equipment without calibration. For the most part as shown in Attachment

A, the incremental readings appear similar to previous readings and the cumulative readings are different especially beneath depths of 40 feet. After reviewing the cumulative readings, a second reading at ARC-1 was taken on July 13<sup>th</sup> to compare with the July 10<sup>th</sup> reading to help ensure the July 10<sup>th</sup> readings from the new equipment was accurate. Attachment D presents the cumulative print out of ARC-1 which shows the two readings were virtually identical.

The data collected on July 10, 2020 appears to follow the same trend as the readings measured in March 2020. The incremental and cumulative displacement plots recorded between September 2016 through July 2020 are presented in Attachment A. Data comparisons for each inclinometer are described below:

Inclinometer ARC-1: The base readings for inclinometer ARC-1 were collected on June 22, 2016. The ARC-1 cumulative plot in the A-Axis direction shows a slight progressive movement starting at depths between 28 and 30 feet. This depth corresponds with the interpreted Alluvium/Pleistocene interface presented in Figure 2 of Arcadis' July 31, 2017 *Final Geotechnical Assessment Report*. After reviewing the cumulative displacement plots, there was a slight increase in displacement between the dates of September 2016 and March 2017. After March 2017, the displacement towards the Rio Grande (A-Axis) started to increase at a slow rate. Comparing the measurements taken in July 2017 to July 2020, the displacement is 0.19 inch towards the Rio Grande (A-Axis) at a depth of 28 feet. The overall displacement at a depth of 28 feet is 0.35 inch.

The displacement parallel to the levee does not show any sign of movement in this month's readings.

Inclinometer Arc-2: The base readings for inclinometer ARC-2 were collected on June 17, 2016. The ARC-2 cumulative displacement plot in the A-Axis direction shows displacement between the depths of 38 feet to 40 feet. This depth corresponds with the interpreted Alluvium/Pleistocene interface presented in Figure 2 of Arcadis' July 31, 2017 *Final Geotechnical Assessment Report*. The cumulative displacement plots show a slight increase in displacement in September 2016 and a decrease in movement in December 2016. After December 2016, the movement towards the Rio Grande (A-Axis) started to increase at a slow rate. Comparing the measurements taken in July 2017 to July 2020, the displacement is 0.08 inches towards the Rio Grande (A-Axis) at a depth of 40 feet. The overall displacement at a depth of 40 feet is 0.25 inch.

The displacement parallel to the levee does not show any sign of movement in this month's readings.

Inclinometer ARC-3: The base readings for inclinometer ARC-3 were collected on June 17, 2016. The ARC-3 cumulative displacement plot in the A-Axis direction shows displacement between the depths of 36 feet to 38 feet. This depth corresponds with the interpreted Alluvium/Pleistocene interface presented in Figure 2 of Arcadis' July 31, 2017 *Final Geotechnical Assessment Report*. Previous readings showed less than 0.1 inch movement at this depth that now shows an overall displacement of 0.15 inch.

The displacement parallel to the levee does not show any sign of movement in this month's readings.

Inclinometer ARC-4: The base readings for inclinometer ARC-4 were collected on June 22, 2016. The ARC-4 cumulative and incremental displacement does not show any sign of movement on the plane perpendicular to the levee nor on the plane parallel to the levee.

After reviewing the cumulative displacement plots in Attachment A, the readings exhibit increasing displacement towards the Rio Grande (A-Axis direction) for inclinometer ARC-1. The displacement for these inclinometers demonstrates a trend that will increase over time due to fluctuations of the water level in the Rio Grande. After critically reviewing the cumulative displacement plots, the graphical displays in Attachment A shows that there is an increase in movement towards the Rio Grande (A-Axis direction) for the

## MEMO

inclinometers ARC-1, ARC-2, and ARC-3. The displacement for these inclinometers is progressive but moving at a very slow rate.

### **ATTACHMENTS:**

**A – Inclinometer Plots**


**B – Inclinometer Location Map**

**C – Site Photos**

**D – Cumulative Plots of Inclinometer ARC-1**


**ATTACHMENT A**  
**INCLINOMETER PLOTS**

IBWC Arc-1 A - Axis

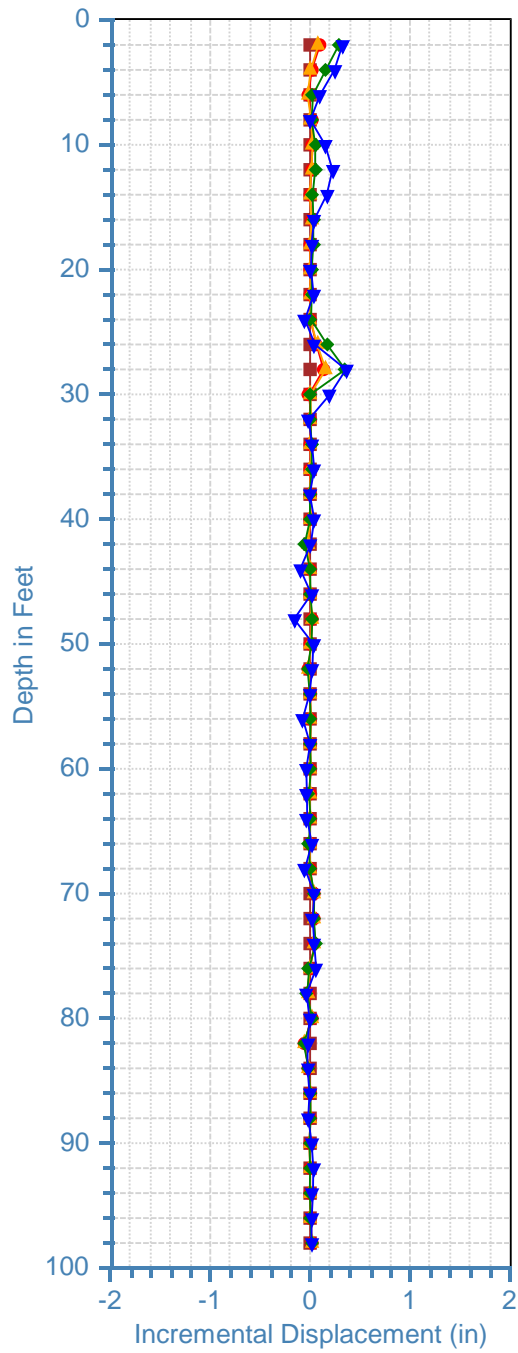

■ 6/22/2016 11:22:30 AM    ● 6/14/2017 12:51:51 PM  
▲ 7/12/2017 9:22:17 AM    ◆ 3/31/2020 1:00:00 PM  
▼ 7/10/2020 2:48:20 PM


IBWC Arc-1 B - Axis

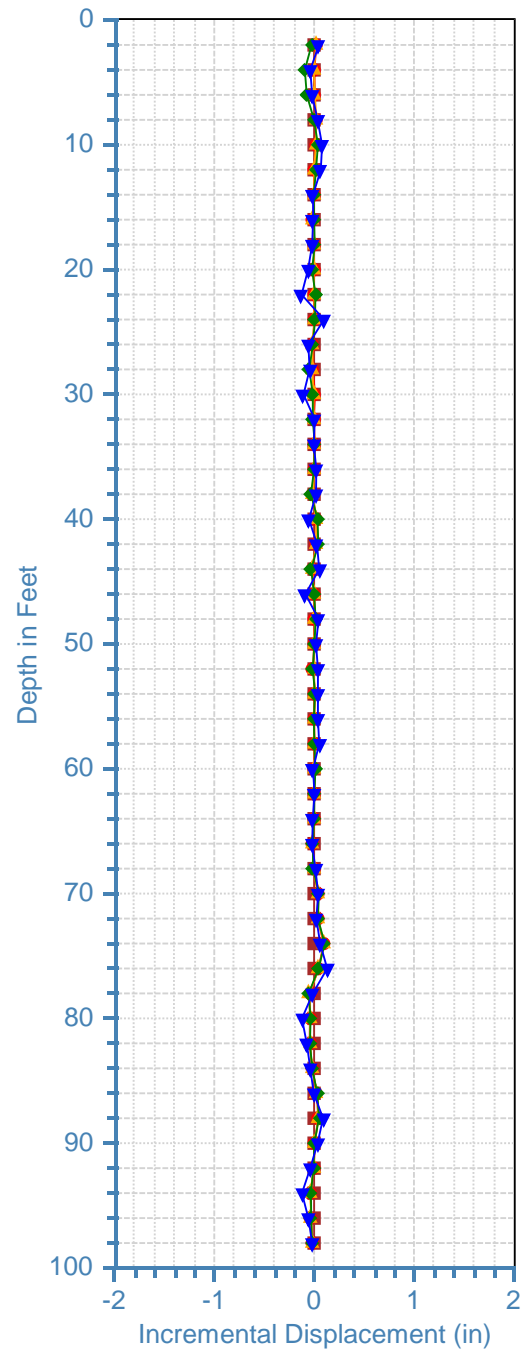

■ 6/22/2016 11:22:30 AM    ● 6/14/2017 12:51:51 PM  
▲ 7/12/2017 9:22:17 AM    ◆ 3/31/2020 1:00:00 PM  
▼ 7/10/2020 2:48:20 PM


Base reading on 6/22/2016

IBWC Arc-1 A - Axis

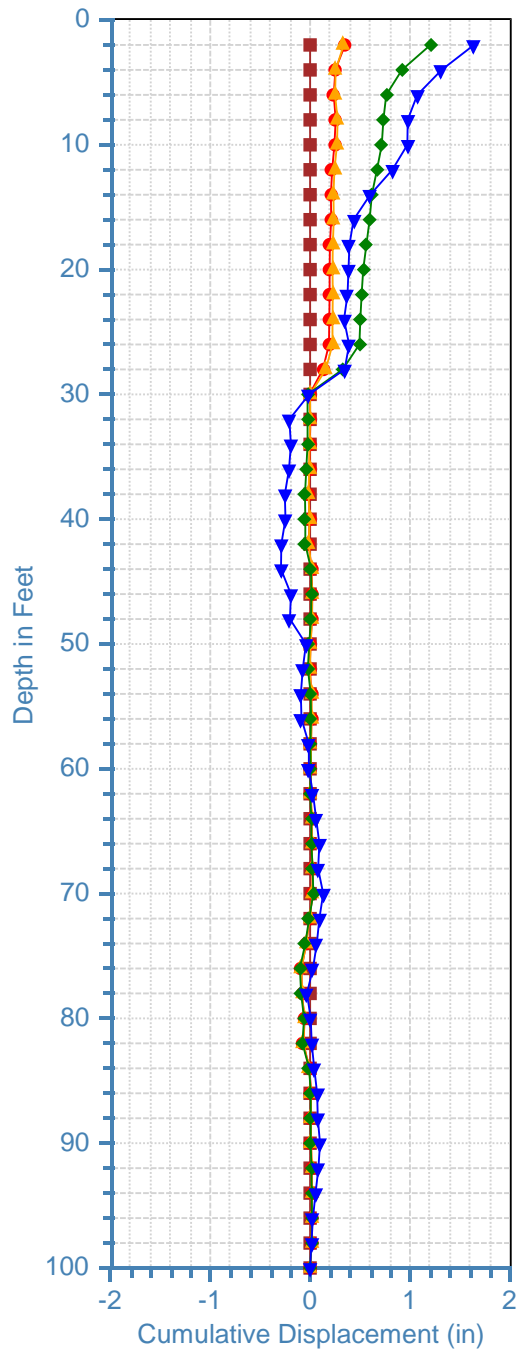

■ 6/22/2016 11:22:30 AM    ● 6/14/2017 12:51:51 PM  
▲ 7/12/2017 9:22:17 AM    ◆ 3/31/2020 1:00:00 PM  
▼ 7/10/2020 2:48:20 PM


IBWC Arc-1 B - Axis

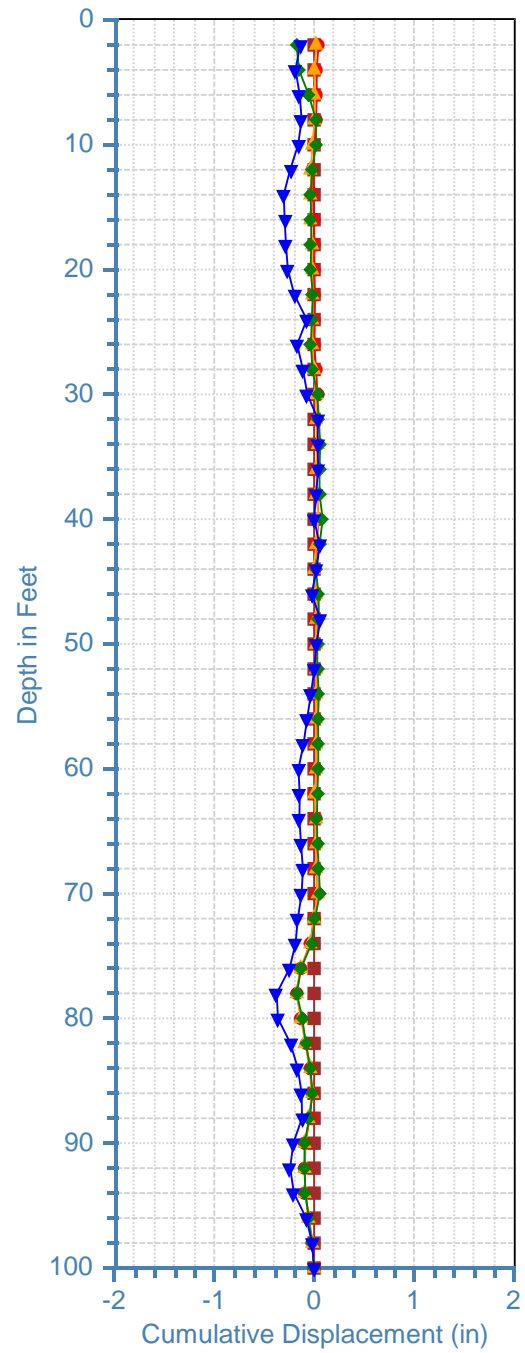

■ 6/22/2016 11:22:30 AM    ● 6/14/2017 12:51:51 PM  
▲ 7/12/2017 9:22:17 AM    ◆ 3/31/2020 1:00:00 PM  
▼ 7/10/2020 2:48:20 PM


Base reading on 6/22/2016

IBWC Arc-2 A - Axis

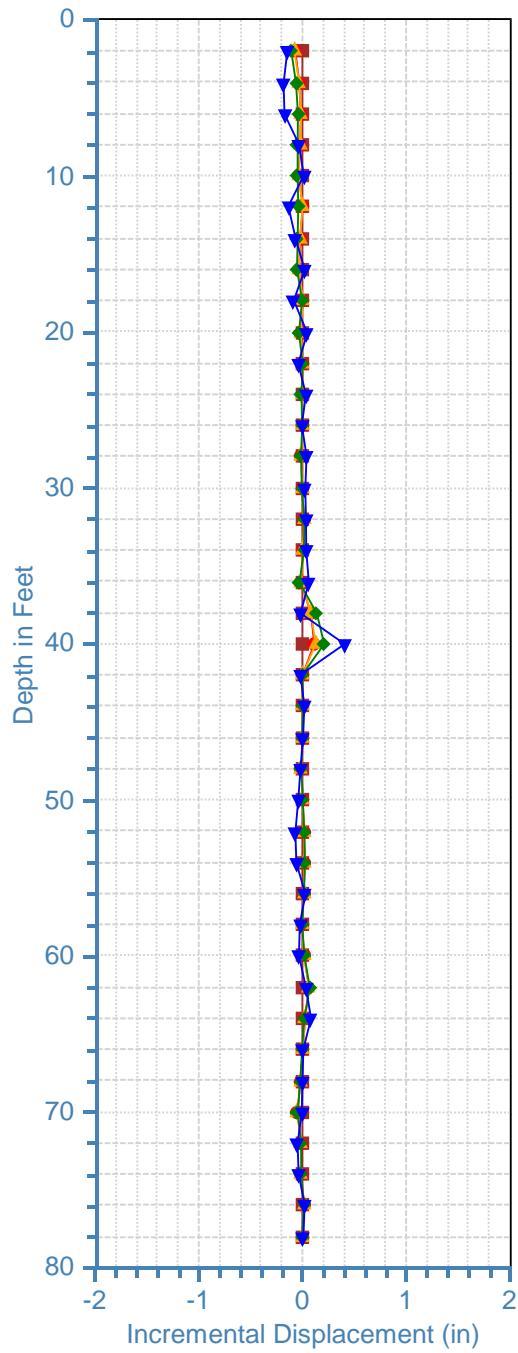

■ 6/17/2016 6:27:13 PM    ● 6/14/2017 1:13:37 PM  
▲ 7/12/2017 8:38:59 AM    ◆ 3/31/2020 12:15:00 PM  
▼ 7/10/2020 2:25:19 PM

IBWC Arc-2 B - Axis

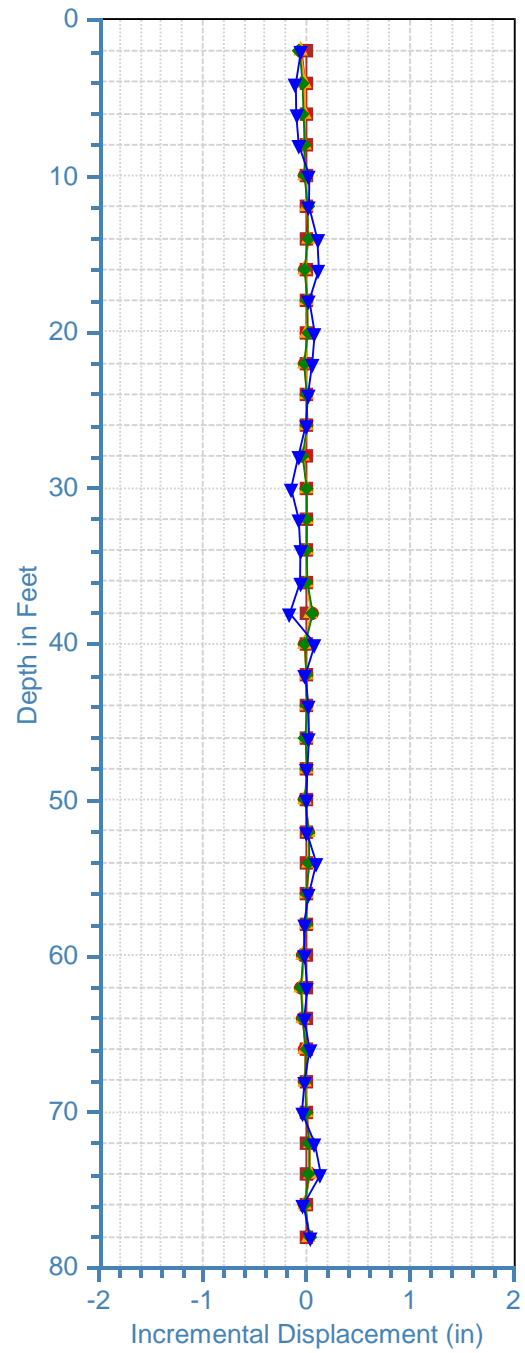


■ 6/17/2016 6:27:13 PM    ● 6/14/2017 1:13:37 PM  
▲ 7/12/2017 8:38:59 AM    ◆ 3/31/2020 12:15:00 PM  
▼ 7/10/2020 2:25:19 PM

Base reading on 6/17/2016




IBWC Arc-2 A - Axis

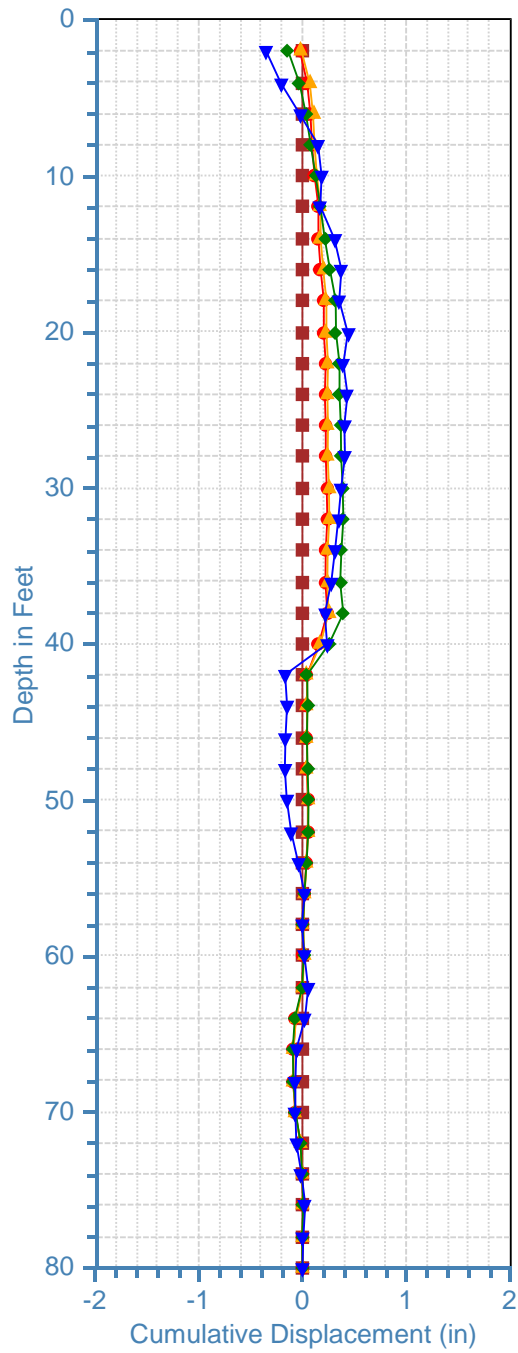

■ 6/17/2016 6:27:13 PM    ● 6/14/2017 1:13:37 PM  
▲ 7/12/2017 8:38:59 AM    ◆ 3/31/2020 12:15:00 PM  
▼ 7/10/2020 2:25:19 PM


IBWC Arc-2 B - Axis

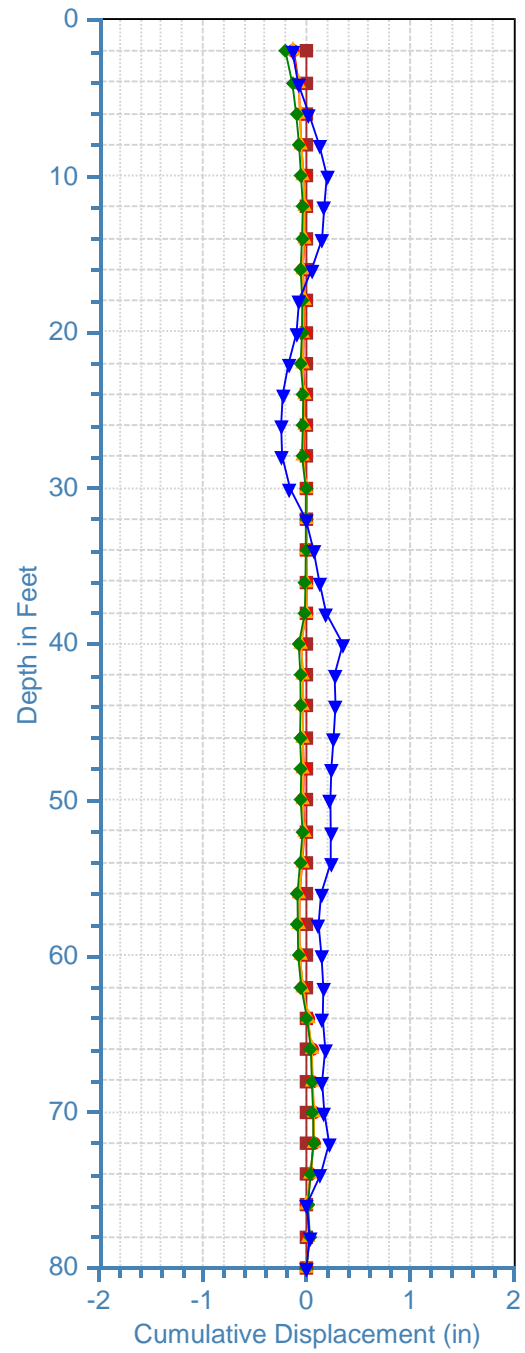

■ 6/17/2016 6:27:13 PM    ● 6/14/2017 1:13:37 PM  
▲ 7/12/2017 8:38:59 AM    ◆ 3/31/2020 12:15:00 PM  
▼ 7/10/2020 2:25:19 PM


Base reading on 6/17/2016

IBWC Arc-3 A - Axis

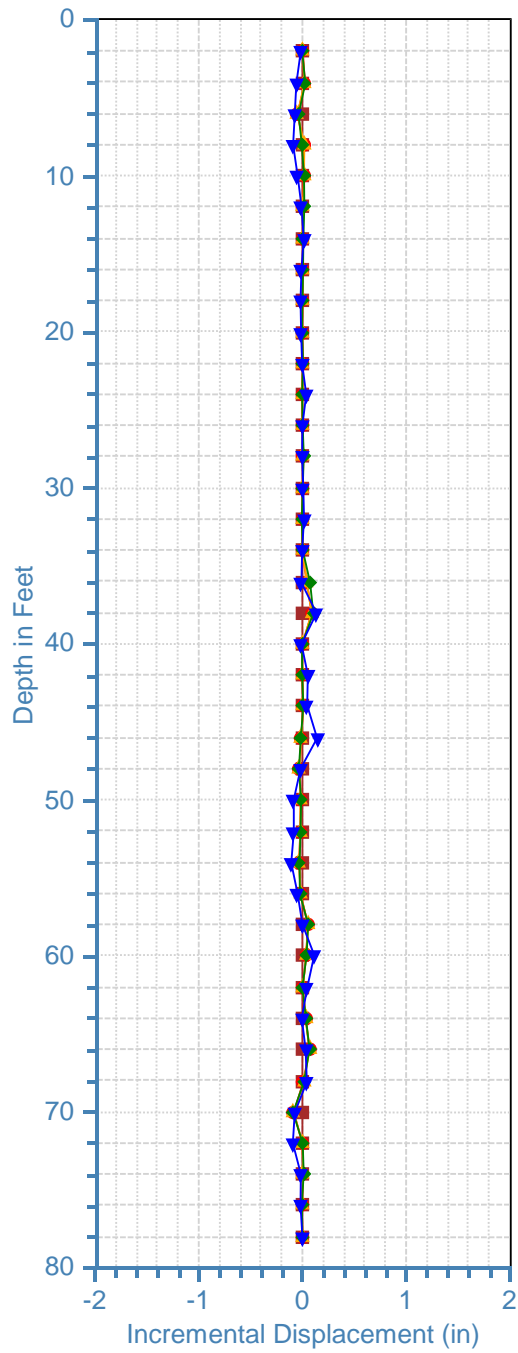

■ 6/17/2016 7:05:22 PM    ● 6/15/2017 3:53:45 PM  
▲ 7/12/2017 8:22:33 AM    ◆ 3/31/2020 11:00:00 AM  
▼ 7/10/2020 2:01:14 PM


IBWC Arc-3 B - Axis

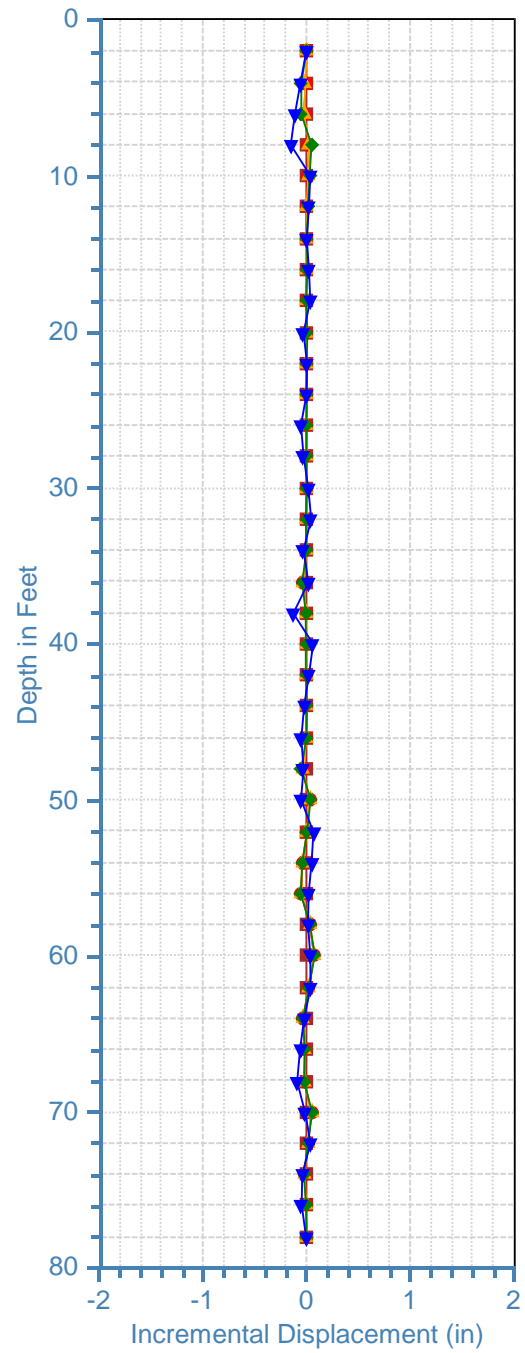

■ 6/17/2016 7:05:22 PM    ● 6/15/2017 3:53:45 PM  
▲ 7/12/2017 8:22:33 AM    ◆ 3/31/2020 11:00:00 AM  
▼ 7/10/2020 2:01:14 PM


Base reading on 6/17/2016

IBWC Arc-3 A - Axis

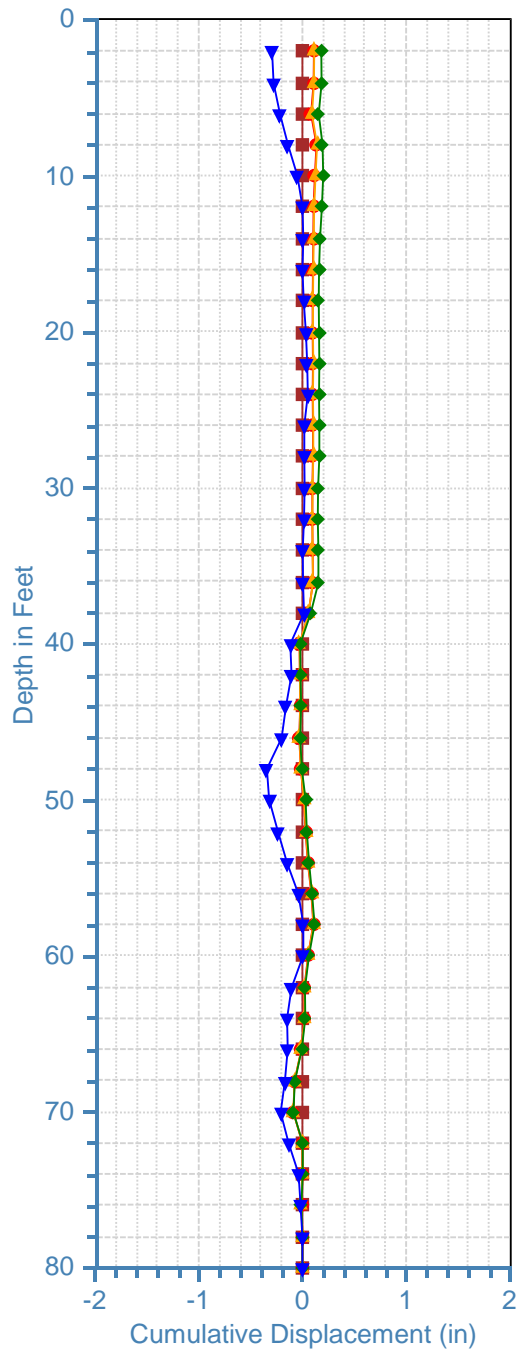

■ 6/17/2016 7:05:22 PM    ● 6/15/2017 3:53:45 PM  
 ▲ 7/12/2017 8:22:33 AM    ◆ 3/31/2020 11:00:00 AM  
 ▼ 7/10/2020 2:01:14 PM


IBWC Arc-3 B - Axis

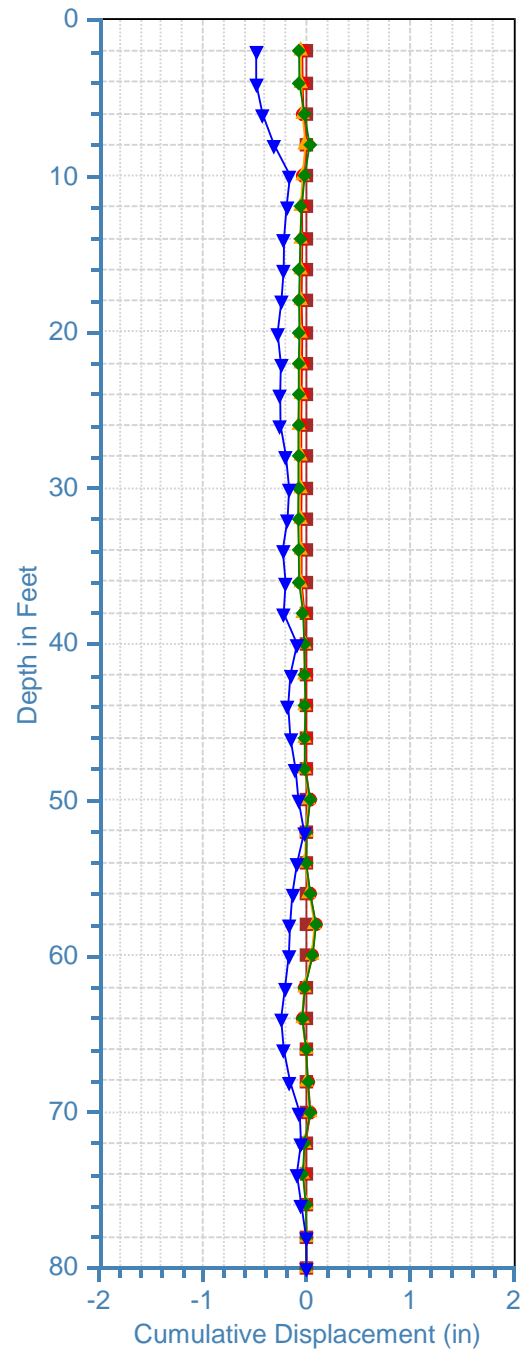

■ 6/17/2016 7:05:22 PM    ● 6/15/2017 3:53:45 PM  
 ▲ 7/12/2017 8:22:33 AM    ◆ 3/31/2020 11:00:00 AM  
 ▼ 7/10/2020 2:01:14 PM


Base reading on 6/17/2016

IBWC Arc-4 A - Axis

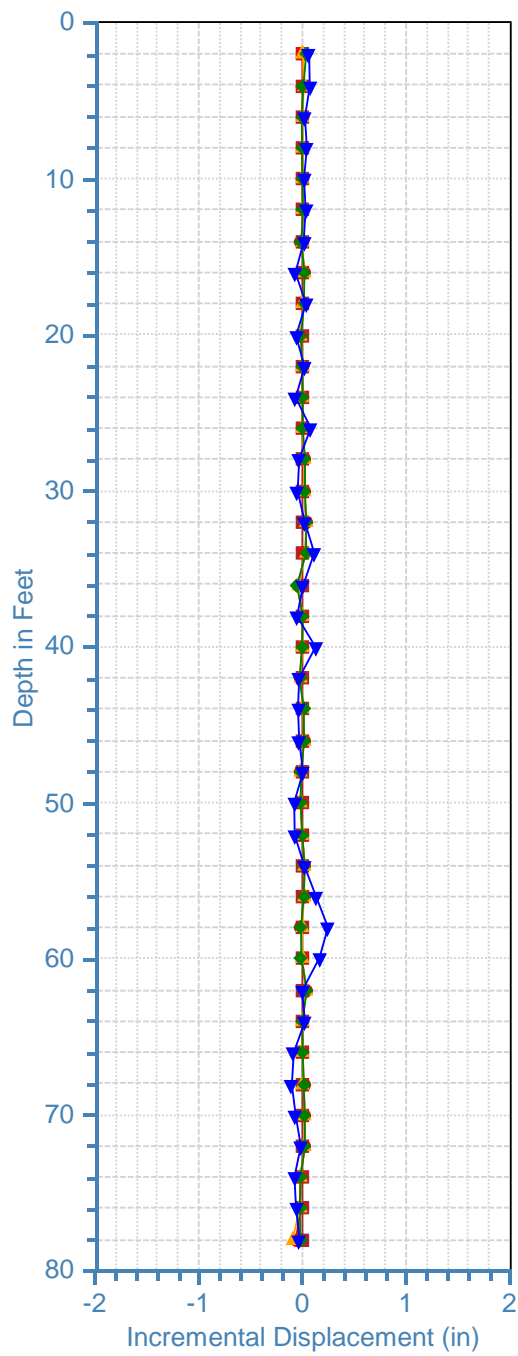

■ 6/22/2016 10:48:04 AM ● 6/14/2017 1:48:14 PM  
▲ 7/12/2017 8:06:31 AM ◆ 3/31/2020 9:30:00 AM  
▼ 7/10/2020 1:39:33 PM


IBWC Arc-4 B - Axis

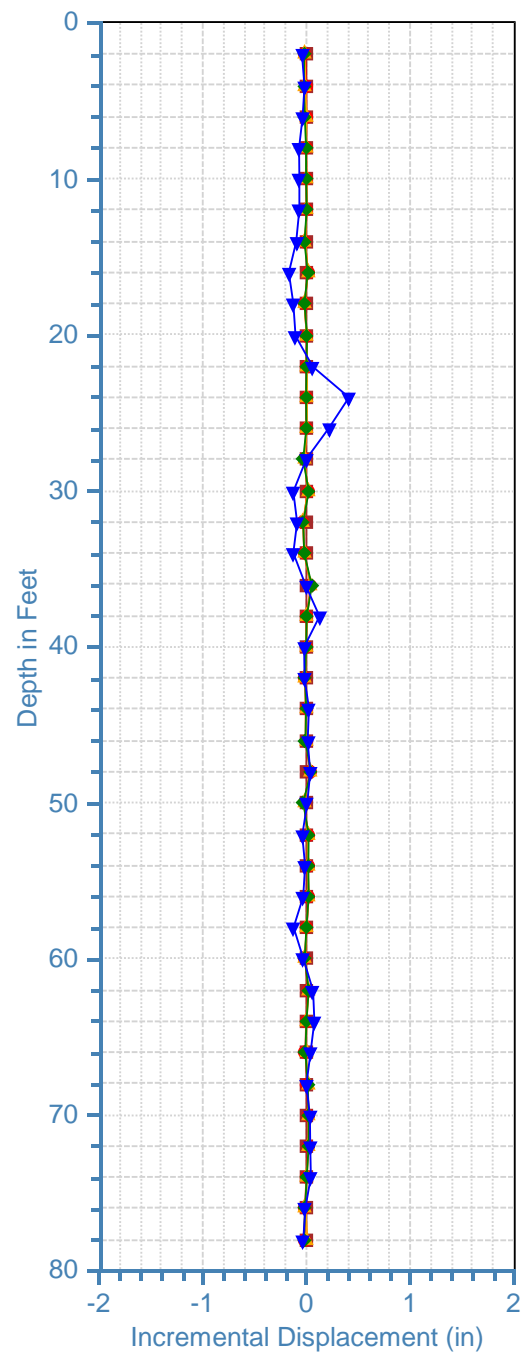

■ 6/22/2016 10:48:04 AM ● 6/14/2017 1:48:14 PM  
▲ 7/12/2017 8:06:31 AM ◆ 3/31/2020 9:30:00 AM  
▼ 7/10/2020 1:39:33 PM


Base reading on 6/22/2016

IBWC Arc-4 A - Axis

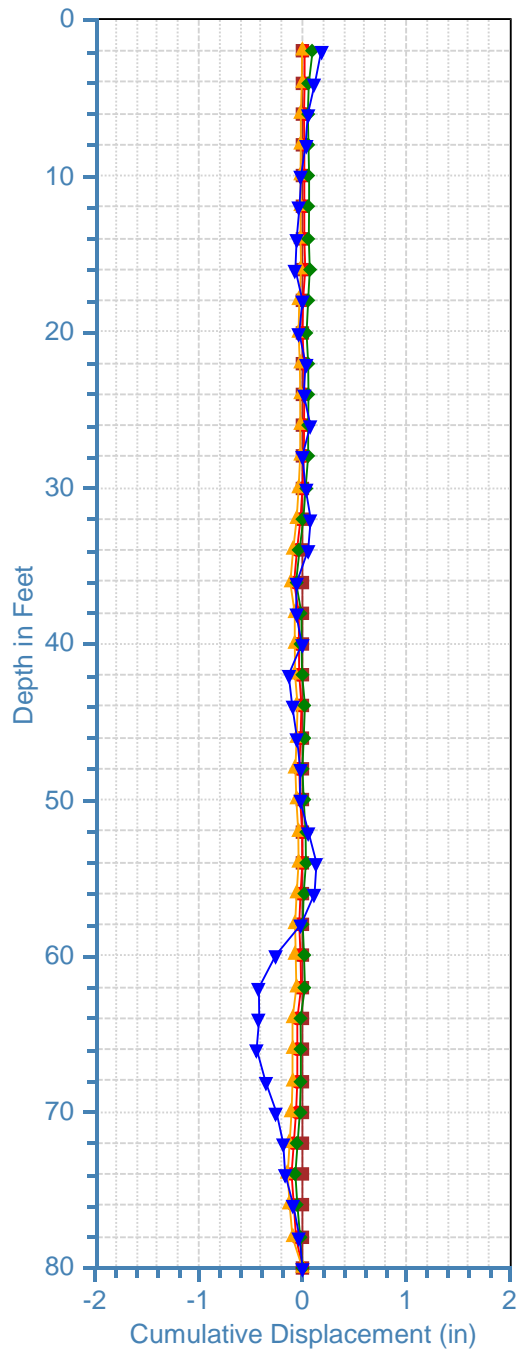

■ 6/22/2016 10:48:04 AM    ● 6/14/2017 1:48:14 PM  
▲ 7/12/2017 8:06:31 AM    ◆ 3/31/2020 9:30:00 AM  
▼ 7/10/2020 1:39:33 PM

IBWC Arc-4 B - Axis

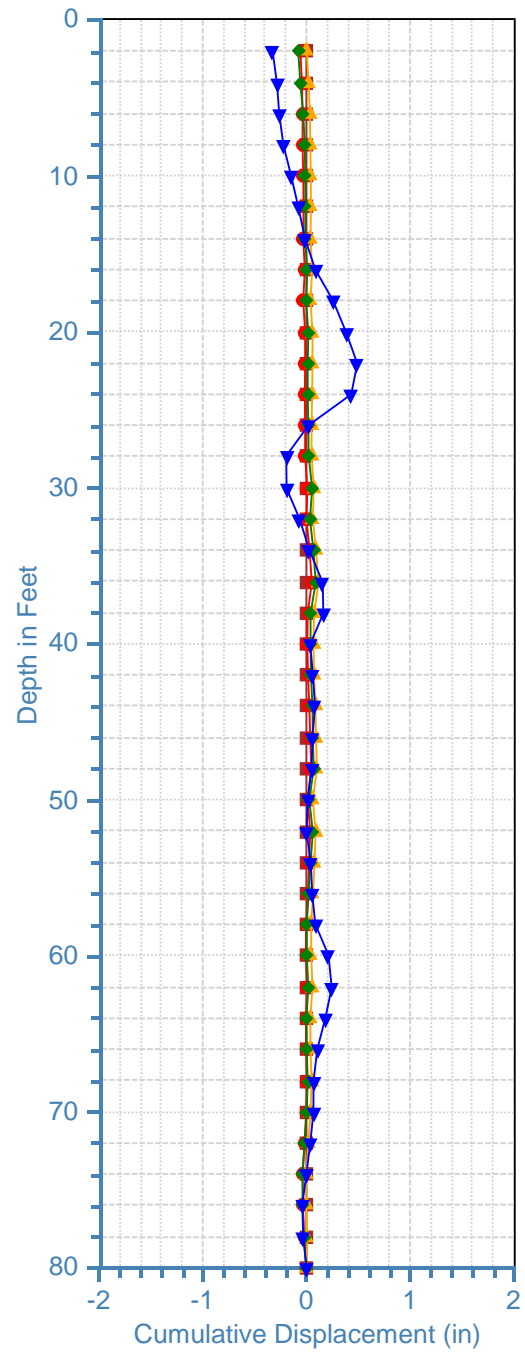

■ 6/22/2016 10:48:04 AM    ● 6/14/2017 1:48:14 PM  
▲ 7/12/2017 8:06:31 AM    ◆ 3/31/2020 9:30:00 AM  
▼ 7/10/2020 1:39:33 PM

Base reading on 6/22/2016

**ATTACHMENT B**  
**INCLINOMETER LOCATION MAP**




DB: R. PETRIE S. BELL LD: SOTHON MEN PIC: (Opt) PM: (Read) TM: (Opt) LVR: (Opt) ON: OFF=REF\* C:\Users\aflores\Desktop\Inclinometer\_CAD File\IBWC\_Inclinometer\_Location Map.dwg PLOTSTYLETABLE: ---- PLOTTED: 4/2/2020 3:22 PM BY: FLORES, ARMANDO



SCALE: 1/2" = 1'

**LEGEND:**

- |   |  |
|---|--|
| <b>B-1:</b> 100 FEET BOREHOLE DRILLED AT THE TOP OF THE LEVEE         | <b>B-3:</b> 80 FEET BOREHOLE DRILLED AT THE EDGE OF THE RIVERBANK                  |
| <b>ARC-1:</b> 98 FEET INCLINOMETER CASING INSTALLED WITHIN BORING B-1 | <b>ARC-3:</b> 78 FEET INCLINOMETER CASING INSTALLED WITHIN BORING B-3              |
| <b>B-2:</b> 80 FEET BOREHOLE DRILLED AT THE TOE OF THE LEVEE          | <b>B-4:</b> 80 FEET BOREHOLE DRILLED NEAR THE NORTH ABUTMENT OF THE GATEWAY BRIDGE |
| <b>ARC-2:</b> 78 FEET INCLINOMETER CASING INSTALLED WITHIN BORING B-2 | <b>ARC-4:</b> 78 FEET INCLINOMETER CASING INSTALLED WITHIN BORING B-4              |



IBWC  
SUMMARY REPORT OF INCLINOMETER READINGS

REMEDATION DESIGN OF LEVEE FLOODPLAIN FAILURE  
WITHIN THE UPPER BROWNSVILLE LEVEE REACH  
LOWER RIO GRANDE FLOOD CONTROL PROJECT  
INCLINOMETER LOCATION MAP

**ARCADIS**

ATTACHMENT  
**B**



**ATTACHMENT C**  
**SITE PHOTOS**





Photo 1 – Looking North – Top of the Levee.



Photo 2 – Looking North – Top of the Levee.





Photo 3 – Looking South – Top of the Levee.



Photo 4 – Looking South – Top of the Levee.






Photo 5 – Looking South – Top of the Levee.

## **ATTACHMENT D**

### **CUMULATIVE PLOTS OF INCLINOMETER ARC-1**


IBWC Arc-1 A

12/31/1969 7/12/2017 3/31/2020  
7/10/2020 7/13/2020

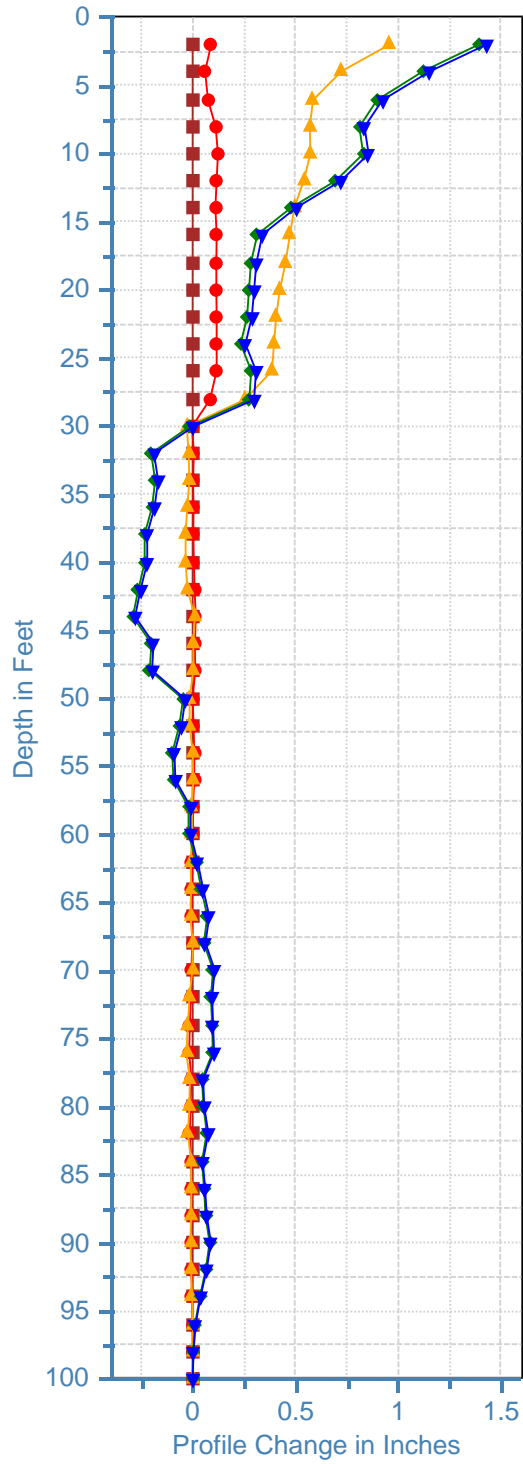

IBWC Arc-1 B

12/31/1969 7/12/2017 3/31/2020  
7/10/2020 7/13/2020

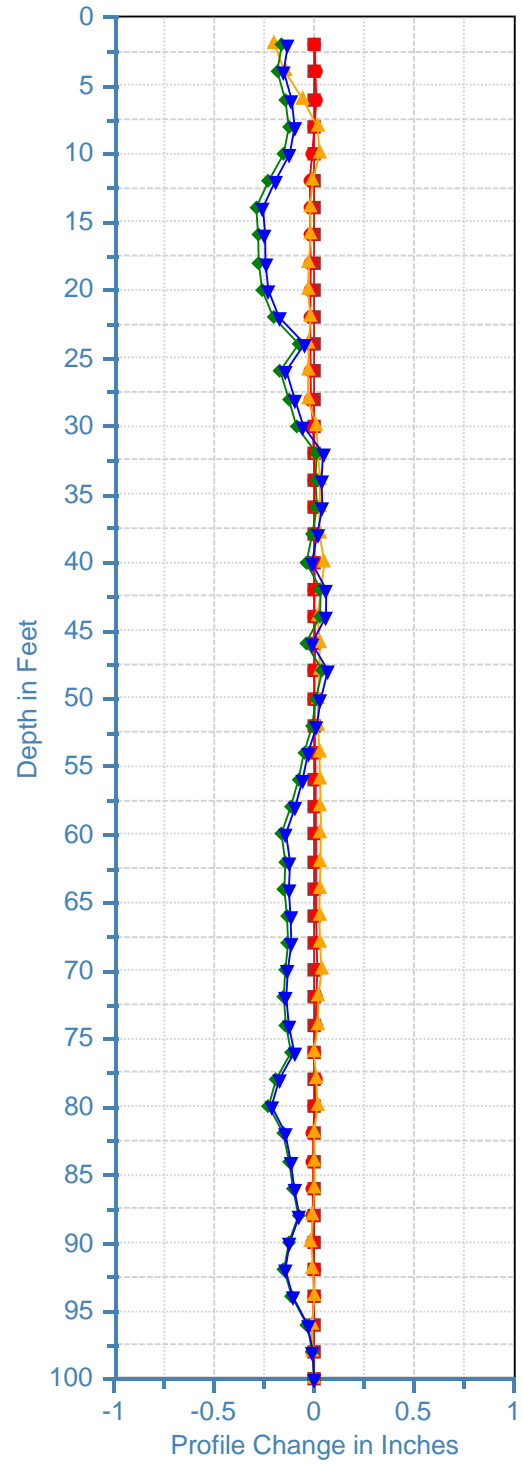

Cumulative Displacement